

FASTENER GROUPS LISTED BELOW ARE USED FOR ASSEMBLY AND INSTALLATION. SOME ASSEMBLY DRILLING IS REQUIRED. PARTITION INSTRUCTIONS & FASTENERS ARE WITH THAT UNIT. USE KD UNIT DRAWINGS TO IDENTIFY THEIR SEPARATE PARTS. CUSTOMER SPECIFIED SHELF DIMENSIONS ARE SHOWN HERE.


ADRIAN STEEL CO.
 906 JAMES STREET
 ADRIAN, MI 49221
 517/265-6194

RACK MODULE

DWG BY: ECN# 6071 DATE 6/8/02 PDS# S/L MD504 ISS. A
 PACKAGE WEIGHT- 97.16 # REF 10232

ITEM	PART NO.	DESCRIPTION	QTY.
1	4A	PARTS TRAY (12X36X2)	1
2	18	SHELF RACK	2
3	MB111	MOUNTING BRACKET	2

SYM.	FASTENERS	QTY	DRILL
●	ASSEMBLY FASTENERS { 1/4-20 X 1 1/2" THP.SCW. (8) } { 1/4-20 HX. FLANGE NUT (8) }	(8)	9/32
●	INSTALLATION FASTENERS ONE CARTON FOR SHIPPING { 1/4-20 PLUSNUT-PB (6) } { 1/4 SPLIT L'WASH (6) } { 1/4 PLN WASHER (6) } { 1/4-20 X 1 HH SCW (6) }	(6)	1/2
⊙	{ 1/4 PLN. WASHER (8) } { 1/4-20 HX.STOP NUT (4) } { 1/4-20 X 1-1/2 HH.SCW.FT (4) } { 1/2 PLN. WASHER (4) }	(8)	9/32
⊕	{ 1/4 PLN. WASHER (4) } { 1/4-20 PLUS NUT"PB" (4) } { 1/4-20 X 1-1/2 HH.SCW.FT (4) } { 1/4 SPLITRING L'WASH (4) }	(4)	13/32

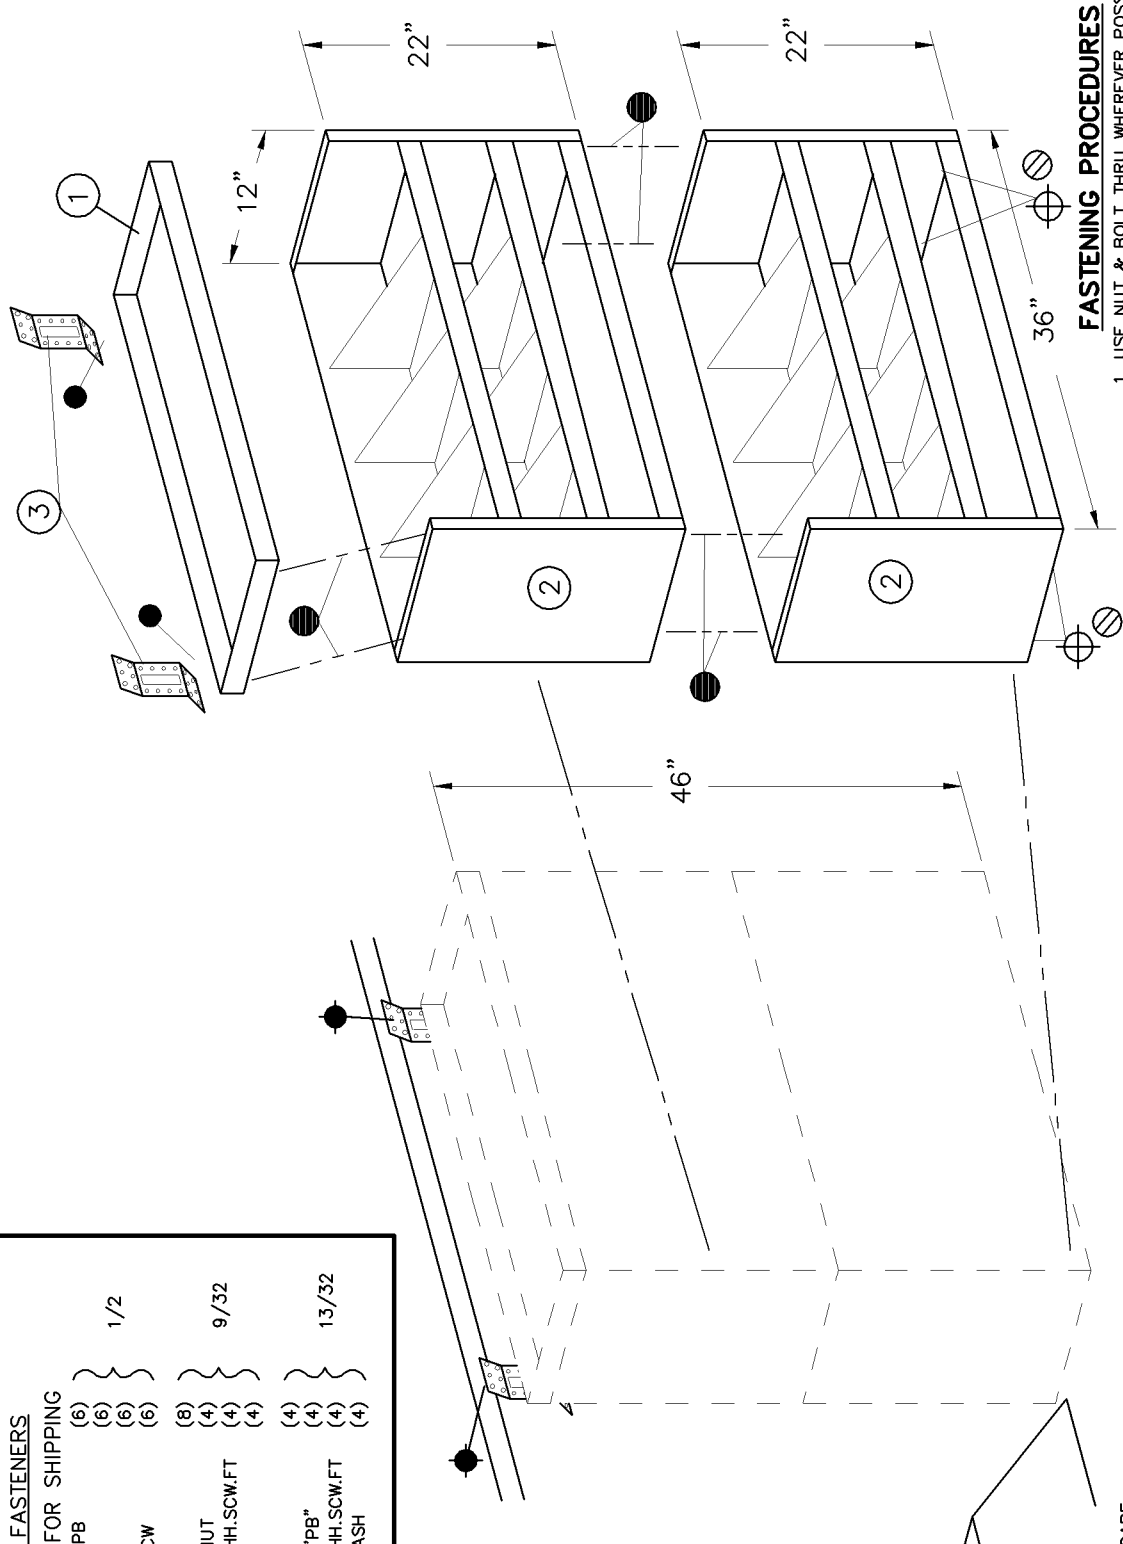

FASTENING PROCEDURES
 1. USE NUT & BOLT THRU WHEREVER POSSIBLE.
 2. USE PLUSNUTS FOR BLIND FASTENING.
 3. AS A LAST RESORT USE SHEET METAL SCREWS.

CAUTION:
 DRILL THRU FLOOR WITH CARE
 WATCH FOR GAS TANK, CONTROL
 LINES, & ELECTRICAL WIRING.